

BIOS Release Notes

TITLE

SUBJECT: MG52-G20 BIOS Release Notes version [F30](#)
System: [MG52-G20-00](#), [G292-280-00](#), [G292-2G0-00](#), [G292-280-000](#), [G292-280-IAY1-000](#), [G292-280-IAP1-000](#)

About This Release

Build Date: [2024/10/30](#)
BIOS Checksum: [0xBF8C076A](#) (32M), [0xA323DD66](#) (64M)
Release Owner: lulu.chuang

BIOS Components/Contents

Processor stepping(s) supported: IntelR Ice Lake-SP processors
System hardware configurations supported: MG52-G20
Microcode updates versions:

CPUID	Family	Microcode Update ID
606a4	IceLake L-0	0b000280
606a5	IceLake C-0	0c0002f0

IPMI support:

AMI Kernel version: [Gbt_Kernel_081_01](#)

Intel CSI/MRC Package version: [30.P50](#)

SPI Descriptor version: [04.04.04.702](#)

OPROM version :

OPROM	Version
INTEL RAID PACKAGE	RSTe 8.0.0.4006
AST2600 VGA	1.13.02

Installation Notes

IMPORTANT NOTES:

1. Please extract the MG52-G20_ [F30](#).zip to a bootable diskette that use FAT/FAT32 format

BIOS UPDATE INSTRUCTIONS FOR EFI Shell:

BIOS Release Notes

1. Insert USB flash drive to system for BIOS upgrade.
2. Power on system and boot to Build-In Shell.
3. Enter your USB filesystem, like "fs0:" or "fsx:", "x" is your USB filesystem number
4. Execute F.nsh for bios update
5. After bios flash finish, system must Power-Off to have the changes take effect.

BIOS UPDATE INSTRUCTIONS FOR Windows:

1. Insert bios update USB flash drive.
2. Use Command Shell.
3. Enter \Tool\Win32 and execute f.bat for Windows 32bit.
Or
Enter \Tool\Win64 and execute f.bat for Windows 64bit.
4. After bios flash finish, system must Power-Off to have the changes take effect.

BIOS UPDATE FOR Easy BIOS Refresh:

1. The system supports remotely update BIOS if BMC existent.
2. Please download the Easy BIOS Refresh User Guide from Gigabyte website, target system support page.

BIOS Version CHECK INSTRUCTIONS:

1. Power on system and press during POST
2. The bios version shows on the first main page

Known Issues/Workarounds

Issues fixed in this version

F30

1. [Feature] Update RC 30.P50
 2. [Feature] Update microcode:
IceLake CPU XCC D0 Production : m_87_606a6_0d0003f5
 3. [Feature] Update ME : SPS_E5_04.04.04.702.0
 4. [Feature] Include INTEL-SA-01153 solution for CVE-2024-28956.
 5. [Feature] Include INTEL-SA-01139 solution for CVE-2024-39279, CVE-2024-28047.
 6. [Feature] Include INTEL-SA-01213 solution for CVE-2024-36293.
 7. [Feature] Include AMI SA50258 solution for CWE-190.
 8. [Feature] Include AMI SA50158 solution for CWE-269.
-

F29

BIOS Release Notes

1. [Bug Fix] Fix PKfail issue.
-

F28

1. [Bug Fix] Fine tune BMC LAN IPv6 configuration page.
-

F27

1. [Feature] Update RC 30.P47 (IceLake BKC 2024.3 IPU-PV)
 2. [Feature] Update microcode: IceLake CPU XCC D0 Production : m_87_606a6_0d0003e7
 3. [Feature] Include Vulnerabilities in EDK2 NetworkPkg for CVE-2023-45236, CVE-2023-45237.
 4. [Feature] Include INTEL-SA-01097 for CVE-2024-24968.
 5. [Feature] Include INTEL-SA-01083 for CVE-2024-24853.
 6. [Feature] Include INTEL-SA-01103 for CVE-2024-23984.
 7. [Feature] Include INTEL-SA-01100 for CVE-2024-24980.
 8. [Feature] Include INTEL-SA-01079 for CVE-2024-21820, CVE-2024-23918.
 9. [Feature] Include INTEL-SA-01071 for CVE-2024-21829, CVE-2024-21781, CVE-2023-43753.
-

F26

1. [Bug Fix] Improve the feature of BMC IPv6 and IPv4 Network setting.
-

F25

1. [Feature] Update for AMI security
SA50216: CVE-2023-39539
SA50216: CVE-2023-39538
-

F24

1. [Feature] Update RC 30.P41 (IceLake BKC 2024.1 IPU-PV)
2. [Feature] Update microcode:
IceLake CPU XCC D0 Production : m_87_606a6_0d0003d1
3. [Feature] Update RSTe : v8.0.0.4006
4. [Feature] Update VROC : v8.0.0.4006
5. [Feature] Update ME : SPS_E5_04.04.04.603.0
6. [Bug Fix] Update for security 2024.1 IPU
INTEL-SA-00950: CVE-2023-23583
INTEL-SA-00960: CVE-2023-22655
INTEL-SA-00923: CVE-2023-35191
7. [Bug Fix] Update for AMI security
SA50236: CVE-2023-5678
SA50229: CVE-2024-3817

BIOS Release Notes

SA50229: CVE-2024-2650

8. [Bug Fix] Update for security of PixieFail: vulnerabilities in Tianocore's EDK II IPv6 network stack.

CVE-2023-45229

CVE-2023-45230

CVE-2023-45231

CVE-2023-45232

CVE-2023-45233

CVE-2023-45234

CVE-2023-45235

F23

1. [Feature] Improve ECC error logging feature set.

F22

1. [Feature] Add "Virtual Numa", "Extended APIC" and "Secure Boot" items into Redfish.

F21

1. [Feature] Update RC 30.P26 (IceLake BKC 2023.3 IPU-PV).

2. [Feature] Update DCPMM UEFI driver v02.00.00.3887.

3. [Feature] Update microcode:

IceLake CPU XCC D0 Production : m_87_606a6_0d0003a5

4. [Feature] Update RSTe : v8.0.0.4006.

5. [Feature] Update VROC : v8.0.0.4006.

6. [Feature] Update ME : SPS_E5_04.04.04.500.0.

7. [Feature] Update for security AMI SA50170.

F20

1. [Bug Fix] Fix the bug about incorrect setup item name.

F19

1. [Feature] Update RC 30.P19 (IceLake BKC 2023.2 IPU-PV)

2. [Feature] Update DCPMM UEFI driver v02.00.00.3887

3. [Feature] Update microcode:

IceLake CPU XCC D0 Production : m_87_606a6_0d000390

4. [Feature] Update RSTe : v7.8.0.1012

5. [Feature] Update VROC : v7.8.0.1012

6. [Feature] Update ME WilsonCity : SPS_E5_04.04.04.301.0

7. [Feature] Update for security 2023.1 IPU INTEL-SA-00700: CVE-2022-21216.

8. [Feature] Update for security 2023.1 IPU INTEL-SA-00717: CVE-2022-32231, CVE-2021-

BIOS Release Notes

0187, CVE-2022-26837.

9. [Feature] Update for security 2023.1 IPU INTEL-SA-00718: CVE-2022-36348
10. [Feature] Update for security 2023.1 IPU INTEL-SA-00730: CVE-2022-33972
11. [Feature] Update for security 2023.1 IPU INTEL-SA-00738: CVE-2022-33196, CVE-2022-33196
12. [Feature] Update for security 2023.1 IPU INTEL-SA-00767: CVE-2022-38090
13. [Feature] Update for security AMI SA50162: CVE-2022-34301, CVE-2022-34302, CVE-2022-34303
14. [Feature] Update for security AMI SA50130

F18

1. [Bug Fix] Fix the bug about remote BIOS item on WEBUI.

F17

1. [Bug Fix] Fix the bug about incorrect information on Redfish.

F16

1. [Feature] Update RC 29.P30 (IceLake BKC 2022 WW40)
2. [Feature] Update DCPMM UEFI driver v02.00.00.3887 (IceLake BKC 2022 WW40)
3. [Feature] Update microcode:
IceLake CPU XCC D0 Production : m_87_606a6_0d00037b
4. [Feature] Update RSTe : v7.7.6.1004
5. [Feature] Update VROC : v7.7.6.1004
6. [Feature] Update ME WilsonCity : SPS_E5_04.04.04.202.0

F15

1. [Bug Fix] Fix the bug about Setup menu incorrect information.

F14

1. [Feature] Import system G292-280-IAY1-000 & G292-280-IAP1-000 setting.

F13

1. [Feature] Import system G292-280-000 setting.

F12

1. [Feature] Update TI solution : A03.

F11

1. [Feature] Update TI solution : A02.
-

BIOS Release Notes

F09

1. [Feature] Update RC 27.P52 (IceLake BKC 2021 WW52)
 2. [Feature] Update DCPMM UEFI driver v02.00.00.3885 (IceLake BKC 2021 WW52)
 3. [Feature] Update microcode:
IceLake LCC CPU : m_97_606a0_80000031
IceLake HCC CPU : m_87_606a4_8b0003f0
IceLake XCC C0 CPU : m_87_606a5_8c0002f0
IceLake XCC D0 CPU : m_87_606a6_8d000280
IceLake CPU HCC Production : m_87_606a4_0b000280
IceLake CPU XCC C0 Production : m_87_606a5_0c0002f0
IceLake CPU XCC D0 Production : m_87_606a6_0d000331
 4. [Feature] Update RSTe : v7.7.0.1054
 5. [Feature] Update VROC : v7.7.0.1054
 6. [Feature] Update ME WilsonCity : SPS_E5_04.04.04.062.0
-

F08

1. [Bug Fix] Fix the bug about incorrect information on WEBUI.
-

F07

1. [Feature] Fine tune system slot name.
-

F06

1. [Feature] Import TI solution : A01.
-

F05

1. [Feature] Add Ti solution.
-

F04

1. [Bug Fix] Fix web UI setting.
-

F03

1. [Feature] Fine tune Phison re-driver setting.
 2. [Bug Fix] Fix the bug about PLX yellow device in windows 2022.
-

F02

1. [Bug Fix] Fix the bug about changing Memory voltage by setup item.
 2. [Feature] Change the setup item PowerPolicy default setting to [Standard].
-

F01

1. [Feature] First release for PVT.

BIOS Release Notes

D14

1. [Bug Fix] Fix some bug about SMBIOS table.
-

D13

1. [Bug Fix] Fix the bug about disable Turbo mode fail.
 2. [Bug Fix] Fix the bug about NVMe hotplug fail.
-

D12

1. [Bug Fix] Fix the VROC incorrect name.
 2. [Bug Fix] Fix incorrect information in subsystem page.
-